

Exhibit 3.3

Hodges Creek Matrix of Required Retrofits to Covered Unit Interiors

HODGES CREEK APARTMENTS: COVERED UNIT INTERIORS


D. INACCESSIBLE FEATURES IN COVERED DWELLING UNITS Unit Types by Building:

Building	Unit Types								Totals	
	1st Floor (Covered Units)				2nd Floor		3rd Floor		Covered Units	Overall
No./ Addr.	2b1b	2b1b A	3b2b	3b2b A	2b1b	3b2b	2b1b	3b2b		
1 2020	0	0	2	0	-	-	-	-	2	2
2 2051	1	5	0	2	6	2	6	2	8	24
3 2010	1*	5	0	2*	6	2	6	2	8	24
Total	2	10	2	4	12	4	12	4	18	50


UNIT TYPE: 2 Bedroom, 1 Bathroom

Surveyed Unit 2051-102 – Typical for 2 total units

Unit Plan. (A03/01).

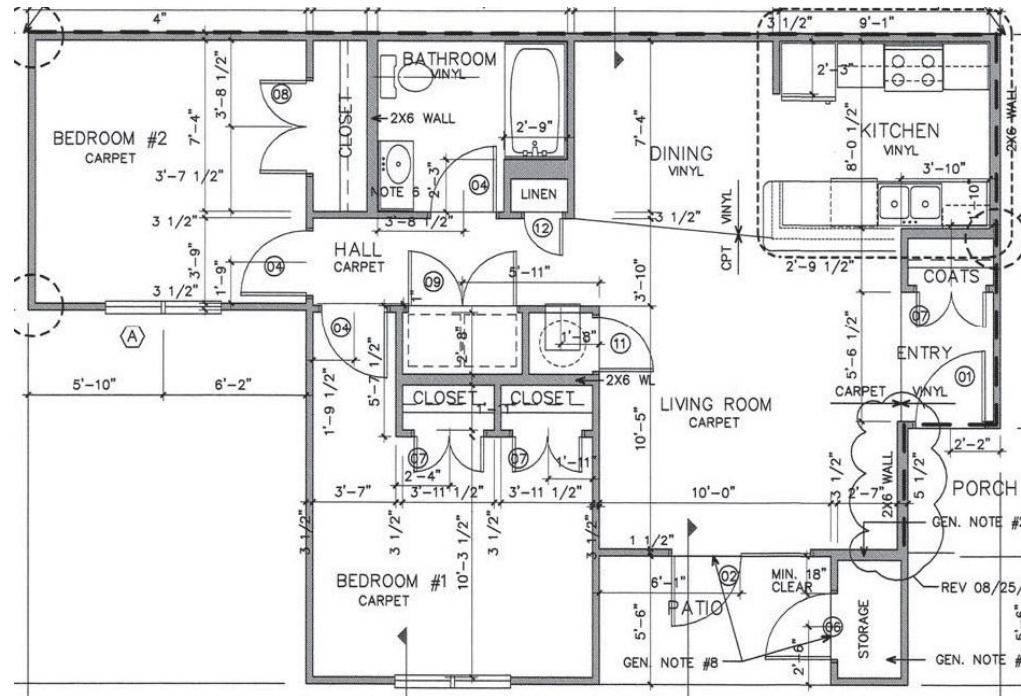

Inaccessible Features:

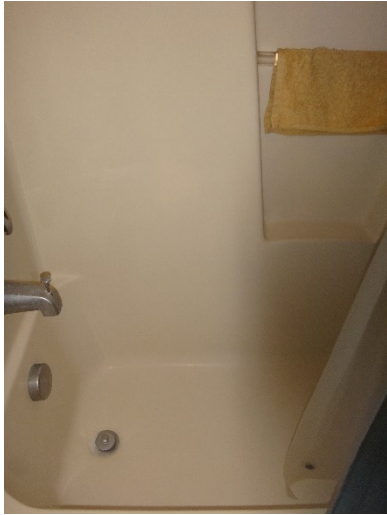Numbers	Photos	Deficiency	Required Retrofit
19		Extent of blocking in bathrooms cannot be determined without destructive testing.	Provide affidavits to confirm that reinforcement is installed to comply with Requirement 6.
20	 <i>Bathtub/shower surround in Unit 2051-102.</i>	The shape of the bathtub surrounds precludes the installation of future grab bars with firm attachment to blocking (ability to install grab bars required).	Remediate upon resident request.

Numbers	Photos	Deficiency	Required Retrofit
21	 <i>Clear floor space obstructed by adjacent refrigerator and range in Unit 2051-102.</i> 	The outlets above kitchen countertops in 2 areas (both sides of the range) lack the required clear floor space for approach (at least 1 outlet in each counter area must have clear floor space for approach).	Subject to tolerances contained in the agreed-upon remediation protocols, modify existing outlet or install a GFI-rated, molded, multi-plug outlet with commercial grade components to bring outlet into compliance with Requirement #5. Any such outlet must be approved by the United States prior to installation.

Numbers	Photos	Deficiency	Required Retrofit
	 <i>Measurement of clear floor space width.</i>  <i>Range extension from countertop.</i>  <i>Clear floor space obstructed by range in Unit 2051-102.</i> 		

Numbers	Photos	Deficiency	Required Retrofit
	 <i>Measurement of clear floor space width.</i>		
22	 <i>Placement of tape between refrigerator and dishwasher in Unit 2051-102.</i>	The clearance between kitchen elements (face of refrigerator to face of dishwasher) is 38-3/4 inches (minimum 40 inches required).	Remediate upon resident request.


Numbers	Photos	Deficiency	Required Retrofit
	 <i>Measurement of clearance.</i>		
23	 <i>Dimension from side wall to centerline of lavatory in Unit 2051-102.</i>	The lavatory centerlines are 18-1/2 inches to the side wall (minimum 24 inches required) and the cabinets are not removable.	Install removable base cabinet to provide clear floor space to comply with Requirement 7(2)(a)(ii).

Numbers	Photos	Deficiency	Required Retrofit
---------	--------	------------	-------------------

UNIT TYPE: 2 Bedroom, 1 Bathroom – (Type A)

Surveyed Unit 2010-104, Unit 2010-105, Unit 2010-106, and Unit 2051-103 – Typical for 10 total units


Unit Plan. (A03/02).

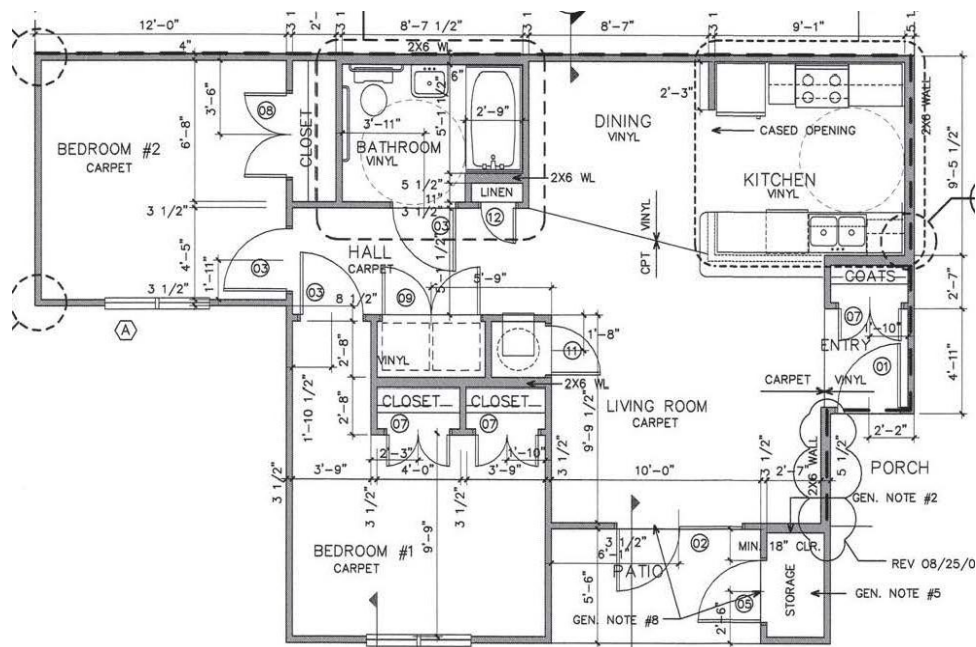

Inaccessible Features:

Numbers	Photos	Deficiency	Required Retrofit				
24	 <i>Entrance door threshold interior side in Unit 2010- 104.</i>	Door thresholds are 5/8 inch high at the interior face and are not beveled (maximum 1/4 inch without bevel allowed).	Modify door thresholds to comply with Requirement 4(4).				
25	 <i>Thermostat in Unit 2010-105.</i>	The thermostat top controls are more than 48 inches above the floor (maximum 48 inches allowed). <table><thead><tr><th><u>Location</u></th><th><u>Height (inches)</u></th></tr></thead><tbody><tr><td>Unit 2010-105</td><td>50-1/8</td></tr></tbody></table>	<u>Location</u>	<u>Height (inches)</u>	Unit 2010-105	50-1/8	Accept proposed fix. Modify thermostat at 50 1/2" to comply with Requirement 5.
<u>Location</u>	<u>Height (inches)</u>						
Unit 2010-105	50-1/8						

Numbers	Photos	Deficiency	Required Retrofit
26	 <i>Clear floor space obstructed by adjacent refrigerator and range in Unit 2010-104</i>  <i>Measurement of clear floor space width.</i>  <i>Projection of range beyond</i>	The outlet above one area of kitchen countertop lacks the required clear floor space for approach (at least 1 outlet in each counter area must have clear floor space for approach). Both the refrigerator and range are greater than 25 inches deep.	Subject to tolerances contained in the agreed-upon remediation protocols, modify existing outlet or install a GFI-rated, molded, multi-plug outlet with commercial grade components to bring outlet into compliance with Requirement #5. Any such outlet must be approved by the United States prior to installation.

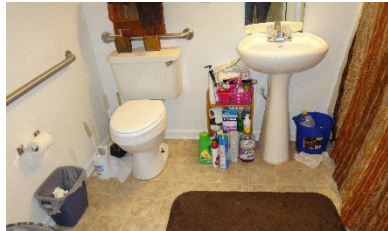Numbers	Photos	Deficiency	Required Retrofit						
	countertop.								
27	 <i>Pedestal sink in Unit 2010- 104.</i>  <i>Measurement from bathtub to lavatory centerline in Unit 2010-104.</i>	The lavatory centerlines are less than 24 inches to the side wall (minimum 24 inches required) and knee space is not provided. <table> <tr> <th>Location</th> <th>Distance (inches)</th> </tr> <tr> <td>Unit 2010-104 bathroom</td> <td>19-1/2</td> </tr> <tr> <td>Unit 2051-103 bathroom</td> <td>18 +/-</td> </tr> </table>	Location	Distance (inches)	Unit 2010-104 bathroom	19-1/2	Unit 2051-103 bathroom	18 +/-	Install removable base cabinet to provide clear floor space to comply with Requirement 7(2)(a)(ii).
Location	Distance (inches)								
Unit 2010-104 bathroom	19-1/2								
Unit 2051-103 bathroom	18 +/-								

Numbers

Photos


Deficiency

Required Retrofit

UNIT TYPE: 3 Bedroom, 2 Bathroom

Surveyed Unit 2020-101 – Typical for 3 total units

Unit Plan. (A03/03).

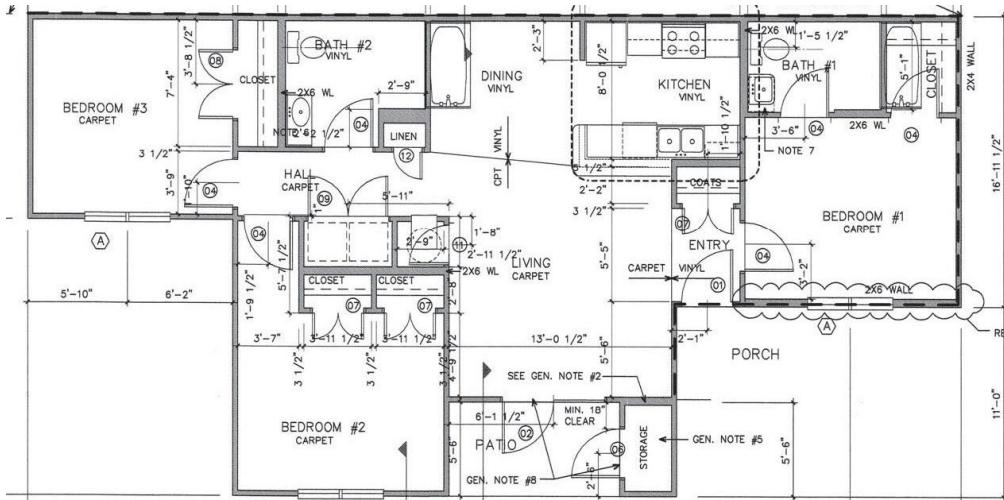

Inaccessible Features:

Numbers	Photos	Deficiency	Required Retrofit
28	 <i>Entrance door threshold interior side at Unit 2020- 101.</i>	Door thresholds are 1/2 inches high at the interior face and are not beveled (maximum 1/4 inch without bevel allowed).	Modify door thresholds to comply with Requirement 4(4).
29	 <i>Measurement of storage room threshold at Unit 2020- 101.</i>	Door thresholds are 3/4 inch high and are not beveled (maximum 1/4 inch without bevel allowed).	Modify door thresholds to comply with Requirement 4(4).

Numbers	Photos	Deficiency	Required Retrofit
30	 <i>Thermostat in Unit 2020-101.</i>	The thermostat top controls are 61 inches above the floor (maximum 48 inches allowed).	Modify thermostat to comply with Requirement 5.
31		Extent of blocking in bathrooms cannot be determined without destructive testing.	Provide affidavits to confirm that reinforcement is installed to comply with Requirement 6.

Numbers	Photos	Deficiency	Required Retrofit
32	 <i>Bathtub/shower surround in Unit 2020-101 hall bathroom.</i>	The shape of the bathtub surrounds precludes the installation of future grab bars with firm attachment to blocking (ability to install grab bars required).	Remediate upon resident request.
33	 <i>Clear floor space obstructed by adjacent refrigerator and range in Unit 2020-101.</i>	The outlets above kitchen countertops in 2 areas (both sides of the range) lack the required clear floor space for approach (at least 1 outlet in each counter area must have clear floor space for approach).	Subject to tolerances contained in the agreed-upon remediation protocols, modify existing outlet or install a GFI-rated, molded, multi-plug outlet with commercial grade components to bring outlet into compliance with Requirement #5.

Numbers	Photos	Deficiency	Required Retrofit
	 <i>Measurement of clear floor space width.</i>  <i>Range extension from countertop.</i>  <i>Refrigerator depth.</i>		Any such outlet must be approved by the United States prior to installation.

Numbers	Photos	Deficiency	Required Retrofit
	 <i>Clear floor space obstructed by range in Unit 2020-101.</i>  <i>Measurement of clear floor space width.</i>		
34	 <i>Placement of tape between refrigerator and countertop in Unit 2020-101.</i>	The clearances between the refrigerator to the opposing countertop are 38-3/4 inches (minimum 40 inches required).	Remediate upon resident request.

Numbers	Photos	Deficiency	Required Retrofit
	 <i>Measurement of clearance.</i>		

Numbers	Photos	Deficiency	Required Retrofit
35	 <i>Lavatory in Unit 2020-101 hall bathroom.</i>  <i>Measurement from side wall to lavatory centerline.</i>	The lavatory centerlines are less than 24 inches to the side wall (minimum 24 inches required) and the cabinets are not removable.	Install removable base cabinet to provide clear floor space to comply with Requirement 7(2)(a)(ii).

Numbers	Photos	Deficiency	Required Retrofit
	 <i>Interior of vanity.</i>		

Numbers	Photos	Deficiency	Required Retrofit
36	 <i>Thermostat in Unit 2051-108</i>	The thermostat top controls are 48-7/8 inches above the floor (maximum 48 inches allowed).	Modify door thresholds to comply with Requirement 4(4).
36a.		Extent of blocking in bathrooms cannot be determined without destructive testing.	Provide affidavits to confirm that reinforcement is installed to comply with Requirement 6.

Numbers	Photos	Deficiency	Required Retrofit
37	 <i>Clear floor space obstructed by adjacent refrigerator and range in Unit 2010-101.</i>  <i>Measurement of clear floor space width.</i>	The outlets above kitchen countertops in 1 area lack the required clear floor space for approach (at least 1 outlet in each counter area must have clear floor space for approach).	Subject to tolerances contained in the agreed-upon remediation protocols, modify existing outlet or install a GFI-rated, molded, multi-plug outlet with commercial grade components to bring outlet into compliance with Requirement #5. Any such outlet must be approved by the United States prior to installation.

Numbers	Photos	Deficiency	Required Retrofit										
38	 <i>Pedestal sink in Unit 2010- 101 master bathroom.</i>  <i>Measurement from side wall to centerline of lavatory in Unit 2010-101 master bathroom.</i>	The lavatory centerlines are less than 24 inches to the side wall (minimum 24 inches required) and knee space is not provided. <table><tr><th><u>Location</u></th><th><u>Distance (inches)</u></th></tr><tr><td>Unit 2010-101 hall bath</td><td>21</td></tr><tr><td>Unit 2010-101 master bath</td><td>15-5/8</td></tr><tr><td>Unit 2051-108 hall bath</td><td>19-1/2</td></tr><tr><td>Unit 2051-108 master bath</td><td>15-5/8</td></tr></table>	<u>Location</u>	<u>Distance (inches)</u>	Unit 2010-101 hall bath	21	Unit 2010-101 master bath	15-5/8	Unit 2051-108 hall bath	19-1/2	Unit 2051-108 master bath	15-5/8	Modify sink to provide clear floor space to comply with Requirement 7(2)(a)(ii).
<u>Location</u>	<u>Distance (inches)</u>												
Unit 2010-101 hall bath	21												
Unit 2010-101 master bath	15-5/8												
Unit 2051-108 hall bath	19-1/2												
Unit 2051-108 master bath	15-5/8												